

CONFORM CHROME APPLICATION INSTRUCTIONS

WARNING! Do not apply this product if application surface has Armor All or other silicone based chemicals on it.

- Application surface must be warm, clean & dry.
- Application temperature no less than 65° f or more than 90° f.

Step 1 **MANDATORY STEP**



Thoroughly wipe surface w/ 70% Isopropyl Alcohol & paper towel.
Using provided **3M** Adhesion Promoter evenly apply a wet thin uniform coating to the bonding surface.
★ Apply promoter immediately after opening packet

NOTE: Use 1 **3M** pad for front & 1 for LT & RT sides

WARNING: Failure to apply **3M** adhesive promoter will cause delamination.

Step 2



NOTE EDGE GAP BEFORE APPLYING

Pre-fit each piece to ensure accurate placement. Make note of edge gap for outside pieces. Once satisfied, peel backing paper exposing adhesive. Starting at the bottom of the cowl lightly tack piece to surface.



Pressing firmly in a side to side motion work your way to the top of each piece.
Be sure to hold top of the part away from surface until you press it down.

TIP: To ensure good adhesion heat the adhesive surface lightly with a safe heat source. (hair dryer / heat gun)

Curved Surface Application

Repeat steps 1 & 2



Pressing firmly in a side to side motion work your way to the top of the cowl. ←→

As you roll over curve be sure to work from the center to outside. This will relieve any stress that may cause the kit to want to lift.

After application of parts, generously apply light heat to kit area to ensure maximum adhesion.

Step 3

Once kit is completely applied, peel clear protective top layer to expose actual chrome surface.

NOTE: Do not peel clear protective coating prior to installing kit.